


QA1 CHARGING TOOL


PART #7791-140

▲ WARNING GAS SHOCK CONTENTS UNDER PRESSURE! USE EXTREME CAUTION WHEN PRESSURIZING OR DEPRESSURIZING SHOCK! FAILURE TO DO SO COULD CAUSE SERIOUS INJURY OR DEATH!

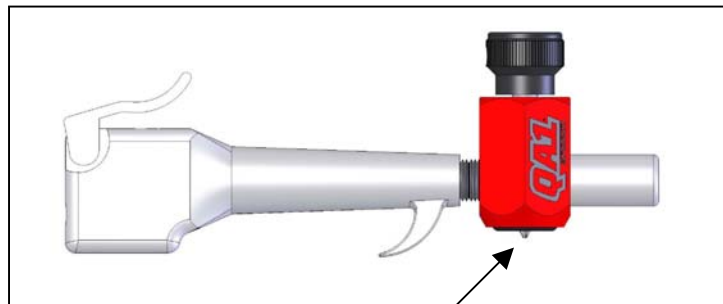

▲ WARNING USE EXTREME CAUTION!
DO NOT put skin or any body part under the fill tool port at any time.

Turn hyper-screw knob counter-clockwise to loosen screw. Turn hyper-screw knob clockwise to tighten screw.

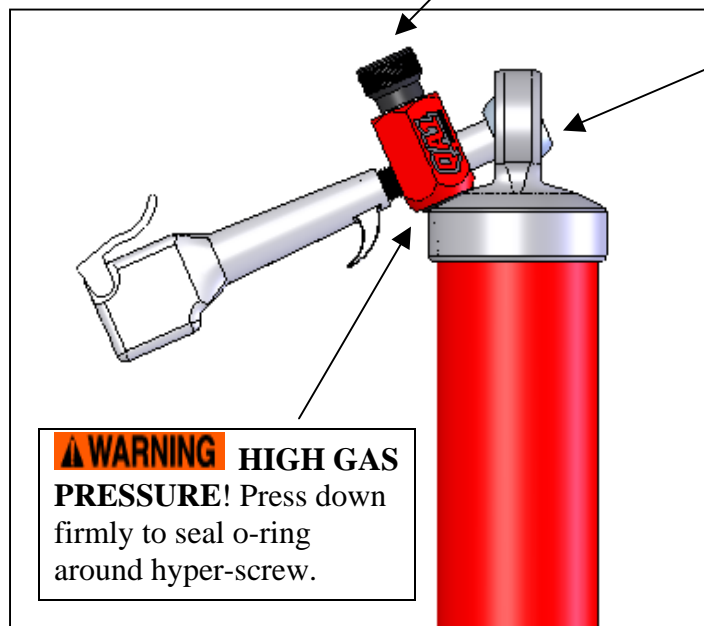

Insert fill tool locator stud into shock eyelet.

▲ WARNING HIGH GAS PRESSURE! Press down firmly to seal o-ring around hyper-screw.